Cat 6 UTP Field Plug Termination

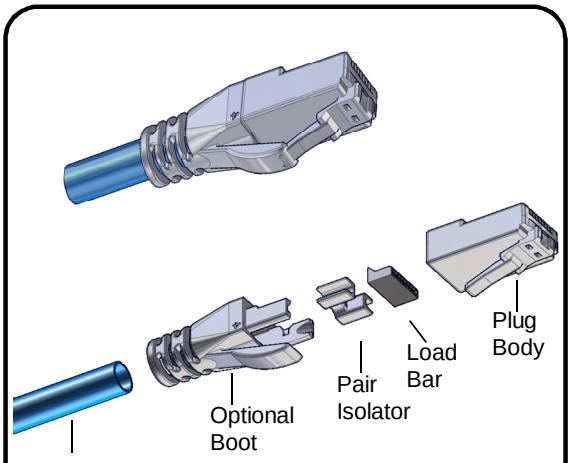

Category 6 UTP
23-26 AWG solid or stranded, conductor insulation 0.037" – 0.042" (.94 – 1.07mm)

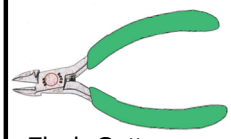

Flush Cutters

Crimp tool
(p/n: PT-908)
with 3-slot die:
(p/n: PT-DIE2-8)

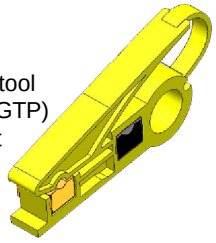

Jacket Strip tool
(p/n: CPT-RGTP)
or equivalent

Tools

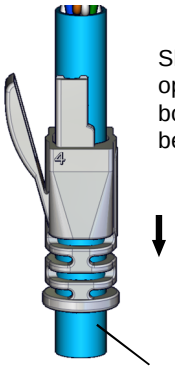

Slide on optional boot if being used

Cable O.D. ≤ 0.25" (6.4 mm)

1

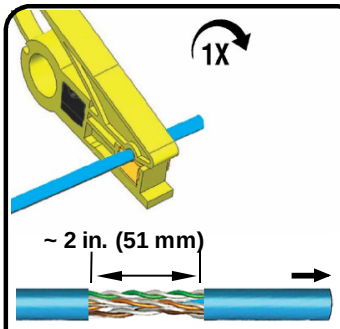

Remove Jacket

2

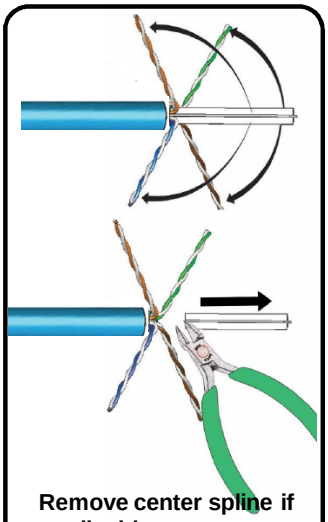

Remove center spline if applicable

3

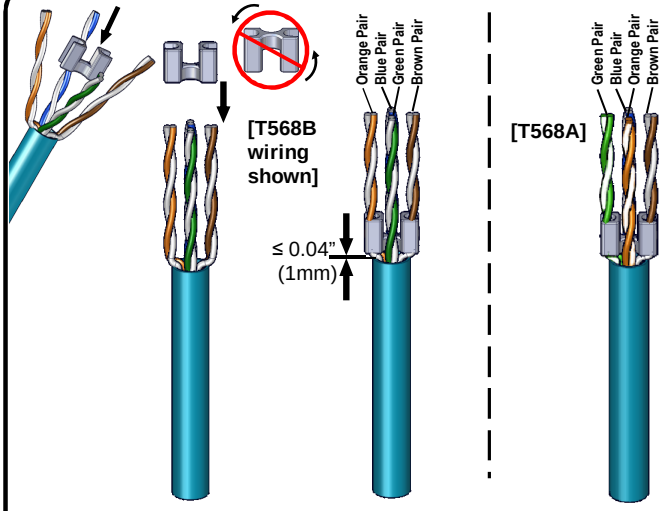

Insert Isolator (notched side away from jacket)

4

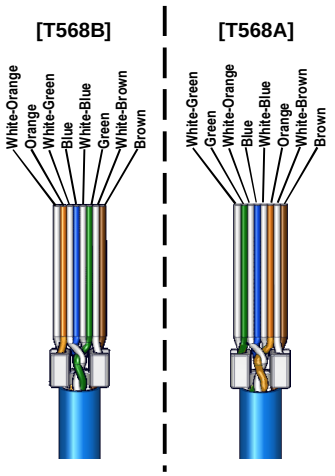

Untwist and flatten pair down to isolator

5

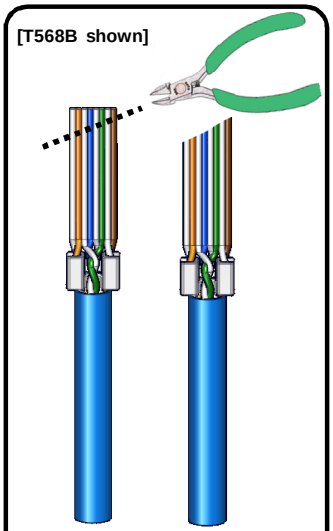

Trim ends clean

6

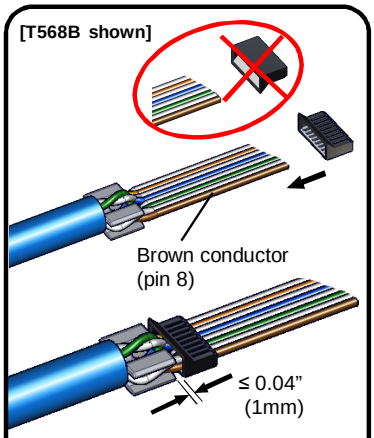

Insert into load bar with brown pair on right and lip side of bar up as shown

7

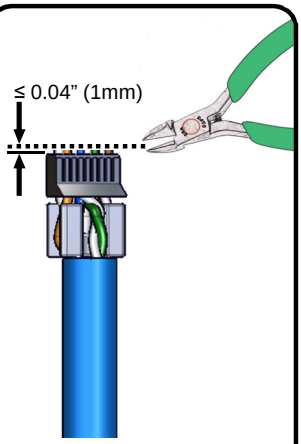

Trim flush with load bar

8

Cat 6 UTP Field Plug Termination

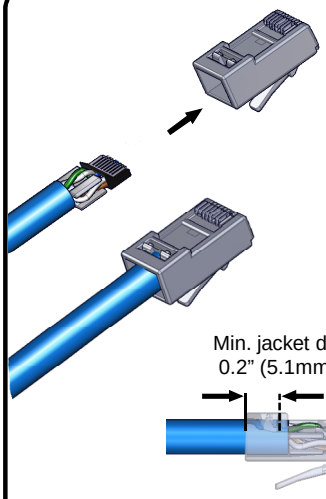

Insert fully into plug body

9

Optional Boot

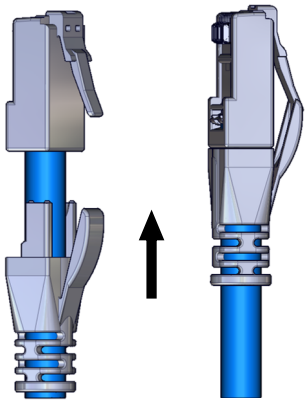

! If using boot, slide into place prior to crimping

10

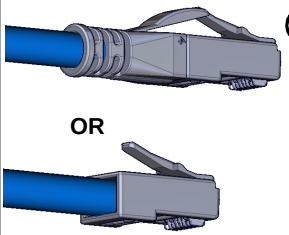

(non-booted version)

Use 3-slot die
(p/n: PT-DIE2-8)

Fully insert assembly into crimp tool and squeeze handles until they release.

11

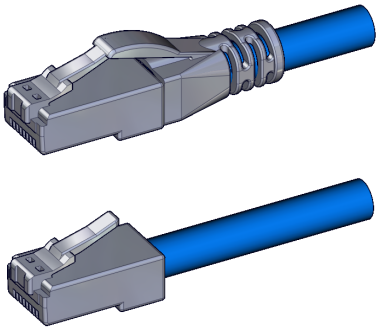

Finished Assembly

12

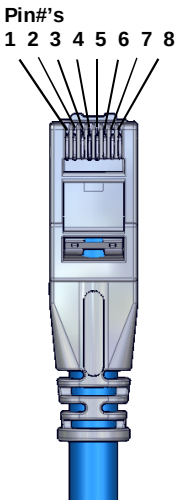

© 2019 Siemon Rev. B 03/19 100.26236.00

To assist safe installations, comply with the following:

A. Use caution when installing or modifying telecommunications circuits.
B. Never touch uninsulated wire terminals unless the circuit has been disconnected.
C. Never install this device in a wet location.
D. Never install wiring during a lightning storm.

Lors de l'installation, respectez les consignes de sécurité suivantes:

A. Utiliser avec prudence lors de l'installation ou de la modification circuits de télécommunications.
B. Ne jamais toucher les bornes de fil métallique non isolés sauf si le circuit a été débranché.
C. Ne jamais installer cet appareil dans un endroit humide.
D. Ne jamais installer pendant un orage.

SIEMON

To ensure you have the latest revision to this document, please visit: www.siemon.com