


SENTINELTM


Connector Systems Inc.

Termination Instructions for 111-08080054L34


1. Components

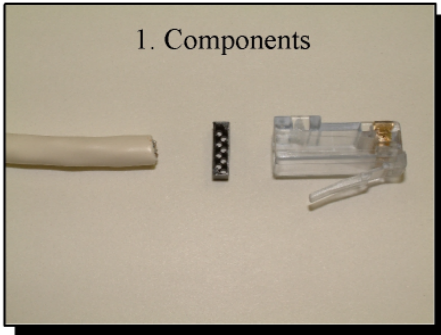


2. Cut Cable Jacket Approx.
1 1/4 inch.

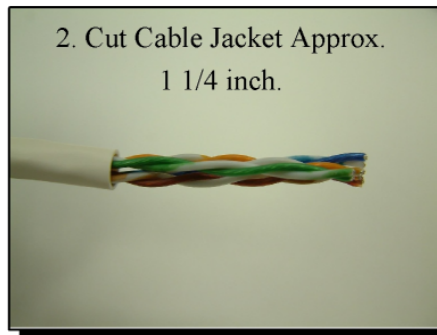


3. Organize Conductors.

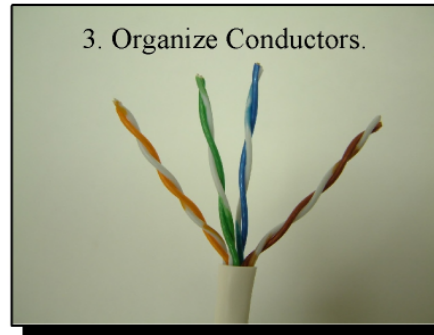

4. Maintain twists in this area.
Do not untwist into jacket.

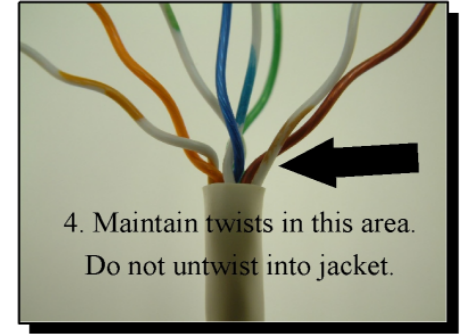


5. Cut conductors straight.

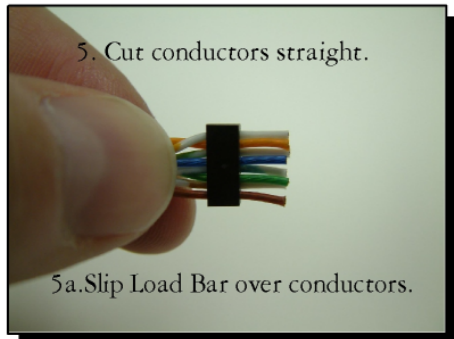


5a. Slip Load Bar over conductors.


6. Push Load Bar up against twists.

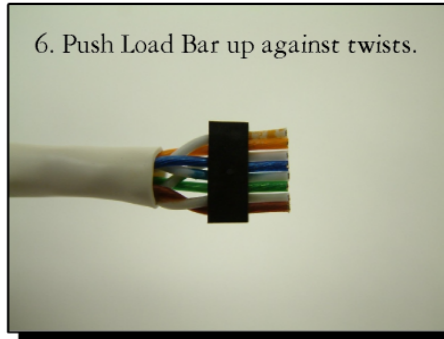


7. Cut length to .140 inch from
front of Load bar to end of
conductors.

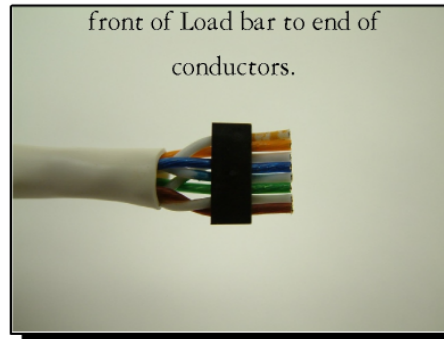


8. Pull Load Bar to end of
conductors.

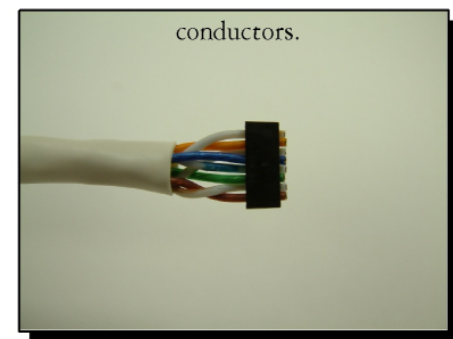

9. Insert into Plug Housing. Push
forward until conductors engage
their openings.

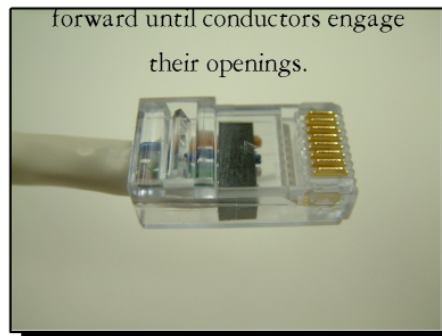

10. Bottom conductors fully in their
openings.

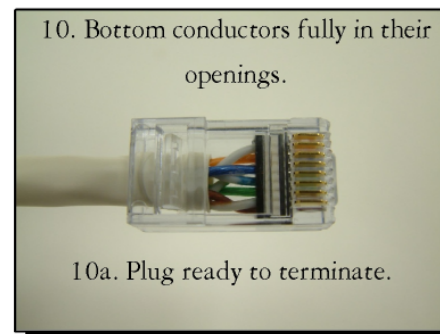

10a. Plug ready to terminate.